



Car Seat Recalls/Defects & Safety Notices - Revised 4/24/25

Ensure you are looking at the most recent list! Scan the code (left) using a smartphone camera or app. This printed list includes recalls on any child restraint manufactured after 1/1/2015 (most recent addition shaded gray). Note: Since most car seats expire in fewer than 10 years from the date of manufacture, some car seats on this list may no longer be covered by the recall notice; rather than be repaired, they should be replaced and properly discarded. Contact the manufacturer for all recall details. Find this list under Resources at www.saferideneews.com. This recall list format was originally developed by the WA State Safety Restraint Coalition and is currently maintained by Safe Ride News Publications.

4moms
888-614-6667 4moms.com

Infant Seat

Self-installing Car Seat made 7/1/16-10/31/16. **Problem:** Hooks that lock the carrier to the base may stick or fail to attach. Until replaced, double check proper locking into base by pulling up on carrier handle; or install carrier without base. **Call:** 888-614-6667 or visit 4moms.com/recalls

Note: These units are now all expired.

Angel Guard

(See Merritt Manufacturing)

Aprica (See Graco; all units expired)

Aria Child (See Goodbaby)

Baby Jogger, LLC

800-241-1848 babyjogger.com

RF-Only/Infant Seats

- **City GO Infant Seat** Models BJ64510, BJ64529;
- **City GO Infant Car Seat Base** Models BJ80400, BJ61500;
- **City Mini Stroller System** Model BJ72510;
- **Vue Lite Stroller System** BJ70411, BJ70424, BJ70431

Made 11/3/14 - 4/30/15.

Problem: Incorrect/missing information on labels/instruction book may decrease correct use of seat increasing risk of injury.

Call: 800-241-1848.

Note: These units are all expired.

Baby Trend

800-328-7363 babytrend.com

Combination Seat

Hybrid 3-in-1 Combination Booster (Desert Blue, from Walmart)

Model: #FB49E14A 12/21

Made on: 12/6/2021

Problem: The LA strap, if frayed, may not meet the strength required by FMVSS 213 and FMVSS 209.

Registered owners will automatically receive a replacement LA attachment and instructions. Until received, install CR using a seat belt.

If a seat belt *cannot* be used, inspect the original LA strap carefully for fraying or other damage and, if in good condition, use it only until it can be replaced.

Call 800-328-7363 for information or search Recalls and Safety Notices at www.babytrend.com.

Hybrid 3-in-1 LX model FB48417 made 7/14/16 sold only at Wal-Mart & model FB58181 made 7/23/16 sold only at Military Exchanges. **Problem:** In a crash, center adjuster may detach in harnessed mode if child weighs more than 40 pounds. **Call:** 800-328-7363 (NOTE: This car seat in harness mode is now expired.)

Bergeron

(No Recalls)
800-371-2778 adaptivemall.com

Britax

888-427-4829 www.britaxusa.com

RF-Only/Infant Seats

B-Safe 35 and B-Safe 35 Elite

Recall #1 of 2:

Made 11/1/15 through 5/31/17.

BOB B-Safe 35 (w/stroller system)

- Beginning E9LT3: 4A, 4C, 5X
- EXLT34A.

B-Safe 35 Models

- Beginning E1A: 183F, 185M, 185P, 186R, 203F, 205M, 205P, 206X, 206Z, 207E
- Beginning E9LU: 65V, 66X, 66Z, 67D, 67E. EXA185M
- Beginning S020: 63600, 63700.
- Beginning S03803: 400, 500, 700, 800, 900
- Beginning S04: 144400, 144500, 144600, 145000, 402800, 884200, 884300, 975600, 978900
- Beginning S0: 5260200, 6020300, 6020400, 6020500, 6020600, 6020700, 6020800, 6020900, 6147100
- S921800

B-Safe 35 Elite Models

- Beginning E1A2: 15T, 15U, 16P, 21Q, 25C, 25U, 26L
- Beginning E9L: S5, 1Q, 6C, 6L, 7F, 7G, 7H
- EXA216L, S923700
- Beginning S0: 1298600, 2063800, 2063900, 2064000, 4281200, 4281300, 4628500, 6018800,

6020000, 6020200

Problem: Center tab on chest clip can break, presenting choking hazard.

Call: 833-474-7016.

Note: These units are now all expired.

Recall #2 of 2:

Made 10/1/14 through 7/1/15

B-Safe 35 (w/stroller system) models beginning S91 plus: 4300, 4500, 4700, 4900, 5400, 5200 **as well as** S921900 and S01635200

B-Safe 35 Models

- EXLU65M
- Beginning E9L plus: U65M, U65P, U63F, U66R, V15M, V15P, V13F.

B-Safe 35 Elite Models beginning E9LS plus: 55T, 56P, 55U, 66C, 65U.

Problem: Car seat carry handle may crack/fracture while being carried. Do not carry by handle until fixed. Recall does not affect seat when used in vehicle or on stroller.

Call: 800-683-2045.

Note: These units are now all expired.

Convertible Seats

Advocate 70-G3, Boulevard 70-G3 and Pavilion 70-G3 models

begin "E9L" J91A, E91M, J91S, J92E, J93P, J93S, K91A, K31A, K31Q, K32D, K32Z, K33Q, L11A, L11Q, L12D, L12Z, G81A, G83N, G83P, G83X, G83Y, L21A, L23P, L23Y made 6/1/12 - 8/31/12.

Problem: Child chewing on HUGS chest pad may bite off small piece, presenting choking hazard.

Call: 888-427-4829

Note: These units are now all expired.

ClickTight Convertible models:

Made 8/1/14 - 7/29/15

Advocate ClickTight Models beginning E9LT plus: 86F, 86G, 86A, 86H, 85Q, 85S and beginning E1A plus: 135Q, 015Q, 016A, and 016H.

Boulevard ClickTight models beginning E1A plus: 013Q, 016A, 016H, 135Q, LT85Q, and

beginning E9LT plus: 85Q, 85S, 86A, 86F, 86G, 86H

Marathon ClickTight models

E1A116L, E9LT76P, E9LT71Q, E9LT76N, E9LT76B, E9LT75R, E9LT76L, E1A006B, E1A005R and EXA116L

Problem: Harness adjuster button (red) may remain down in release position and prevent harness from

locking. Continue using seat while awaiting repair only if harness button does not stick and harness remains tensioned.

Call: 888-427-4829.

Note: Check date; most units are now expired.

All-in-One Seat

One4Life Slim ClickTight models

E1D197A, E1D197B, E1D197F, E1D197G; made July 10-12, 2024

Problem: The child weight limit for using the LA attachment to install the CR rear facing is incorrectly stated on labels and in owner's manuals. The RF LA attachment child weight limit should be 35 pounds.

Call: 888-427-4829

BubbleBum

(No Recalls)
800-969-6586 bubblebum.co/us

Carfoldio

(No Recalls)
mifold.com; [out of business](http://outofbusiness.com)

CARES

(No Recalls; airplane only)
800-299-6249 kidsfllysafe.com

Century

(No Recalls)
centurybaby.com

Chicco

877-424-4226 chiccousa.com

Combination Seat

MyFit Zip Air

Model: 07079561970070 and 04079561190070

Made: 9/1/2020—8/31/2024

Problem: In situations in which the CR is in recline positions 3 or 4 (most upright), is installed using a lap-only belt, and the tether is not attached, a child riding in the CR's harness mode may experience more chest acceleration in a crash than what is allowed by FMVSS 213. Until the recall is repaired, the CR is safe to use in booster mode or in harness mode if it is installed using the LA attachment or a lap-shoulder belt (and tether), or a lap-only belt with a tether, as stated in instructions.

Call 877-424-4226

CLEK Inc.

866-656-2462

clekinc.com

RF-Only /Infant Seats

Liing Model LG19U1 and

Liingo Model LGO20U1

Problem #1 of 2: On units made prior to 9/15/2020, the canopy support can break under pressure, posing a choking hazard if small pieces are ingested by a child.

Call: 866-656-2462 for a stronger canopy stay; it's safe to use the CR until fixed if canopy is intact.

Problem #2 of 2: On units made prior to 2/22/2021, labels on the seat padding and insert may detach, posing a choking hazard if ingested.

Call: 866-656-2462 for replacement pad/insert; it's safe to use the CR until fixed if labels are intact.

Convertible Seats

Flo Model FL15-FO19 and

Foof Model FO12-FO19

Made: prior to 5/21/21.

Problem: Pieces of foam cushion from under the padding can be picked loose by the child, posing a choking hazard if ingested.

Call: 866-656-2462 for a plastic insert; monitor child behavior until the repair kit is applied.

Booster Seats

Olli Model OL12U2 made 1/20/20 through 5/10/22

Ozzi Model OZ11U2 made 3/1/2020 through 5/10/22.

Problem: Diagram for lap-and-shoulder belt routing not on label.

Call: 866-656-2462 for a new label; refer to owner's manual for belt use instructions until label replaced.

Columbia Medical

(See Inspired by Drive)

Columbus Trading-Partners U.S.A, Inc.

(See CYBEX)

Combi USA, Inc.

RF-Only/Infant Seats

BabyRide RF-only car seat (no base), model #378099, manufacture dates 5/1/2016—8/31/2019.

Problem: The webbing of the 1-inch harness adjuster strap fails to meet the breaking strength requirement of FMVSS 213. Since the segment of this strap that falls *behind* the A-lock adjuster is part of the overall harness, this strength issue could potentially

cause an infant to be improperly restrained in a crash.

IMPORTANT NOTES: This model is branded by its manufacturer, Nania. During a portion of the recall period, units labeled as Nania BabyRide were imported into the U.S. through a now defunct distributor, Team-Tex America. Therefore, Nania and/or Team-Tex may be prominent on the CR, packaging, and ordering information, whereas Combi, the most recent importer, may not be indicated (but is responsible).

BabyRide is a CR with no base that states no minimum weight (allowing use "from birth"), sold exclusively through institutional distributors, so most units in circulation have been provided to caregivers through distribution programs. These programs are advised to check inventory and notify clientele. (Check carefully for expiration; most units are expired.)

Contact: Email customerservice@combiusa.com; no remedy announced as of print date.

Convertible Seats

Coccoro Model 8220

Made 1/1/09 through 7/31/16.

Problem #1 of 2: When installed FF and secured with vehicle LAP-ONLY belt, excessive force may be transferred to the car seat.

(Note: Recall does not affect rear-facing mode or when the car seat is installed forward facing with a lap/shoulder belt and lock-off or lower anchors and tether.)

Problem #2 of 2: Made 1/6/09 - 12/5/12. Harness webbing fails to meet minimum strength requirements.

Contact: Combi no longer has U.S. support

Note: Problem #2 units are expired.

Convaid

(See Etac)

844-876-6245

etac.us.com

Cosco

(See Dorel)

CYBEX

877-242-5676

cybex-online.com

RF-Only/Infant Seats

Aton G (any variety) made before 5/10/24. Inclusive of models with or without Swivel and SensorSafe in the name, as well as units that are part of the Eos or Aton G stroller/travel systems.

Problem: If the shell has been slid or scraped over a hard edge (like a table, countertop, or the base), plastic fingers on the shell's underside may bend,

which may allow the harness hip anchoring pin(s) to become dislodged, so the harness will not properly secure the child. If the plastic fingers aren't bent and the harness is anchored properly, the CR may be used until the fix kit is added; however, advise caregivers to check the harness before each use and to avoid rough handling of the CR, which contributes to this issue.

Call: 877-242-5676 to contact CYBEX distributor Columbia Trading Partners.

Aton made 3/29/17-1/4/20.

Aton Q made 3/13/17-1/3/20.

Aton M made 3/17/18-11/1/20.

Aton 2 made 3/29/17-10/27/20.

Cloud Q made 7/6/17-10/20/20.

Problem: The webbing for the one-inch central harness adjuster strap may fray too easily; when frayed, the webbing fails to meet strength requirements of FMVSS 213. The recall kit has a new harness adjuster strap (with end not folded/sewn) and instructions for replacement. (Owners who previously incurred a cost for replacement due to this problem should call, as well.)

Call: 877-242-5676

Convertible Seat

Cybox Sirona M models

518000385, 518002153, 518000387, 518002145, 518002149, 518002151, and 519000211, made 11/3/17 through 8/31/18.

Problem: It's possible for a child to pick pieces of foam from the headrest padding, which could be an ingestion/choking hazard.

Call: 877-242-5676 to get a manufacturer-provided tape kit with instructions for how to apply it to the lower edge of the headrest's EPS foam. The car seat is safe to use while awaiting the fix, provided caregivers understand that they must monitor children to ensure they do not pick at foam.

Diono 855-242-5676 diono.com

All-in-1 Seats

Radian RXT, Radian R100, Radian R120, Rainier, Olympia, & Pacifica made 11/25/2013-9/25/2017.

Problem: The seat may not adequately protect a child *when used in harnessed mode & installed forward-facing*.

Children using seat in booster mode are not affected. Forward-facing children using the harness, who weigh more than 65 pounds (with any installation method) MUST use top tether. For vehicles not equipped with tether anchor, use seat in booster mode. Forward-facing children using the harness who weigh 65 pounds or less whose seat is installed with a lap-only belt in vehicles without a tether anchor MUST install repair kit.

Call: 855-215-4951.

Booster Seat

Cambria 2 booster model numbers 31200-US-01, 31201-US-01, and 31202-US-01 made 9/5/2020, through 11/30/2020, and used in highback mode.

Problem: The headrest may crack and possibly separate from the booster during a crash. Diono will provide a replacement seat back. The replacement seat back does not have padding; the instructions will say to transfer the original padding to the replacement seat back and how to attach the seat back to the seat.

Call: 855-463-4666.

Dorel Juvenile Group

(Cosco, Eddie Bauer, Safety 1st, Maxi-Cosi) 800-544-1108 digusa.com

RF-Only/Infant Seats

The base of the following models, all made February 2023 or earlier, with a self-retracting system for the LA attachment. Note: Does not include CRs with similar names that have non-retracting LA attachments.

Maxi-Cosi:

Coral XP (#IC313) made 5/1/20-2/28/23. (Also, see next recall.)

Mico XP (#IC336, #IC38) made 9/1/20-2/28/23.

Mico XP Max (#IC337) made 9/1/20-2/28/23.

Mico Luxe+, (#IC370) made 9/1/20-2/28/23.

Any replacement base with self-retracting LA attachment (#IC335) made 5/1/20-2/28/23.

Safety 1st:

onBoard 35 Secure Tech (#IC351) made 5/1/20-2/28/23.

Any replacement base with self-retracting LA attachment (**Secure Tech**) pre-2/23/23

Also, the recalled base may be part of these travel systems: Gia XP, Zelia 2 Max, Tayla, Tayla XP, Adorra, Mara XT, and Lila CP (Canada).

Problem: The LA attachment system may not hold the base properly. Owner's will be sent a new base. Until received, install the CR with the base (or baseless) using the vehicle seat belt only.

Call: Contact Dorel at 877-657-9546 or send an email to RetractableLatchRecall@djgusa.com

Maxi-Cosi Coral XP #IC313, all dates. (Also, see prior recall.)

Problem: The inner carrier cannot be installed in the car without the use of a supplemental device (the outer carrier) and therefore the CR fails to meet FMVSS 213 requirements, including those regarding installation and dynamic performance. Until a refund or replacement has been issued, the CR's inner carrier may be installed while properly attached to the outer carrier, per all instructions.

Call: 877-657-9546 or email CoralXPRecall@djgusa.com.

Convertible Seats

Maxi-Cosi Pria 70, Pria 85 and Pria 85 Max,

Made Jan. 1, 2019–Sept. 8, 2021

Problem: The car seat allows more forward head movement than allowed by FMVSS 213 *when used by a child weighing more than 65 pounds and installed forward-facing using a lap-only belt and no tether*. (CRs properly used in rear-facing mode are not affected.)

The recall fix from Dorel is new instructions and labeling that limit use of the CR to a maximum child size of 65 pounds or 49 inches for any forward-facing installation. Owners using or intending to use the CR for a child over 65 pounds may request a free Maxi-Cosi Rodi Sport booster. Until fixed, follow these new instructions. Always attach the tether when used forward-facing, whenever possible.
Call: 877-657-9546 or email pria85recall@djgusa.com.

Combination Seats

Safety 1st Grow & Go Sprint all models beginning CC321. (These model numbers end in GYU, GYUD, GYY, GYD, HAO, or HAR and were made February to December 2023.)

Problem: The foam pad under the child's head is not adequately secured. If it becomes loose, a child can pick at it and choke. Dorel will send a replacement head pad with assembly instructions. While awaiting the kit, ensure foam is in place and warn caregivers to be alert to this risk.

Call: 877-657-9546 or go to gng-sprint-recall@djgusa.com

Safety 1st Boost & Go (all numbers beginning BC163 made

5/30/2023–3/7/2025),

Boost & Go Essential

(all numbers beginning BC181 made 1/29/2024–3/7/2025),

Comfort Ride (all numbers beginning BC159 made 2/28/2023–3/7/2025), and

Disney Baby MagicSquad (all numbers beginning BC167 made 7/17/2023–3/7/2025).

Problem: The CR label incorrectly states that the height allowed for harness use is from 43–57 inches (110.1–144.8 cm). Until the recall fix has been applied, warn owners that the harness is not suitable for children taller than 49 inches. (The owner's manual correctly states the height range as 34–49 inches.) Dorel will send registered owners a corrected label to place over the incorrect label.

Call: 877-657-9546 or go to comfort-ride-recall@djgusa.com.

Booster Seat

Babideal Model "Storm," #BC901BPXL, made 2/28/19 and sold at Family Dollar stores. **Problem:** Some required safety labels are missing, and some present labels are for non-vehicle boosters only (wrongly indicating the booster should not be used in vehicles).

Call: 877-657-9546 to get a new fabric cover with appropriate labels.

Etac (incl. Convoid, R82)

844-876-6245 etac.us.com

R82 Quokka made May 2019.

Problem: A non-recall, consumer advisory: Some units, upon unboxing, have been found to have a broken RF belt guide.

Call: Consumers with this problem should call 844-876-6245 to order a free fix kit with instructions.

Evenflo

800-233-5921 evenflo.com

RF-Only/Infant Seats

LiteMax CRs included in the following travel systems: Gold Shyft (#53212311C), Sibby (#562118976C), Folio3 (#57312205C), Gold Pivot Expand Modular (#53112311C), and Omni Plus (#53312418C) made 1/1/18–12/31/24.

LiteMax 35 base, #6391600C, made 1/1/18–12/31/24.

SafeMax CRs included in the following travel systems: Pivot (#56012477C) and Pivot XPand (#57112454C) made 1/1/18–

12/31/24.

Problem: The CRs were prepared for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Convertible Seats

Sonos (#3471205C)

Tribute (Factory Select, #3811198C) made 1/1/18–12/31/24.

Problem: The CRs were prepared for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Momentum 65 (LX and DLX)

Models beginning "385" made 3/4/13–8/26/13.

Sure Ride DLX Models beginning with "371" made 6/20/12–10/17/13.

Titan 65 Models beginning "371" made 6/20/12–10/17/13.

Problem: Harness buckle may become stuck in latched position making it difficult to remove child. For new buckle **Call:** 800-490-7591. (Note: These units are now all expired.)

Titan 65, made 5/20/22: An issued recall applied to only one unit, which had missing labels. The CR was returned to Evenflo and destroyed. No other CRs in the field are expected to have this problem.

All-in-1 Seats

EveryFit (#CS300212376C, CS300212408C)

EveryKid (#CS300212340C)

EveryStage DLX (#39212241C)

Gold Revolve 360 Extend (#38412311C)

Symphony DLX (#34612173C, #34631038C)

Symphony Elite (#34611709C),

Symphony Sport (#34512335C), made 1/1/18–12/31/24.

Problem: The CRs were prepared for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In

the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Combination Seats

Maestro Sport (#34912200C, #34912258C)

Problem: The CRs were made for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Evolve # 34411700 and 344117421 made before 2/9/16.

Transitions #34411686, 34411695, and 34411029 made 12/18/14–1/29/16.

Problem: In harness mode, child may reach button and loosen harness.

Call: 800-233-5921.

Note: These units are now all expired.

Booster Seats

Amp (#34011243C)

Big Kid LX (#31912381C)

Go Time Sport (#35012433C)

Spectrum (#34212036C) made 1/1/18–12/31/24.

Problem: The boosters were prepared for sale in Canada but shipped to the U.S., so the recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their booster at www.evenflo.com.

Call: 800-233-5921.

E-Z-On Products (No Recalls)

800-323-6598 ezonpro.com

Goodbaby USA

(See Evenflo and Cybex)

Graco

800-345-4109 gracobaby.com

Convertible Seats

Classic Ride model #1812930 made 3/1/14–2/28/15. **Problem:** Label missing information on instruction book location.

Call: 800-345-4109.

Note: These units are now all expired.

Comfort Sport models 1794333, 1813040 made 3/1/14-2/28/15.
Problem Label missing information on instruction book location.
Call: 800-345-4109.
Note: These units are now all expired.

Extend2Fit model 1954477 made 11/27/15-1/20/16.

Problem: Recline label affixed to wrong location may result in infant too upright or toddler too reclined. To confirm unit is affected by recall, also check the recline labels (including the one identifying recline positions 1-6); on each side of seat, they should all be one language (English one side, Spanish the other. If they are not in same language, the unit is subject to this recall.

Call: 800-345-4109

Ready Ride Models 1924519, 1923520 made 3/1/14-2/28/15.

Problem: Label does not show owner's manual location. (Also see buckle recall earlier on this list.)

Call: 800-345-4109

Note: These units are now all expired.

All-in-1 Seats

Milestone Models 1910130, 1923980, 1926538, 1926539 made 7/9/15-10/9/15. **Problem:** Labels do not have required wording about how to install seat with LATCH or seat belt per FMVSS 213. Recall does not affect safety performance.

Call: 800-345-4109 for new label.

Booster Seats

Turbo Booster Models:

- 1963973 made 3/8/16-4/2/16
- 1963974 made 12/22/15-3/30/16
- 1963975 made 12/22/15-3/17/16
- 1963976 made 2/17/16-3/24/16
- 1967886 made 1/13/16-4/5/16
- 1975173 made 3/29/16

Problem: Owner's manual omits instruction to prevent seat from becoming projectile by buckling it when not in use. Seat is still effective to restrain child. **Call:** 800-345-4109.

Harmony

877-306-1001 harmonyjuvenile.com

Big Boost Deluxe made 11/1/15-6/24/17. **Problem:** In a crash, seat belt may cause excessive force on child's chest increasing risk of injury. **Call:** 877-306-1001. (Check for expiration.)

Hauck/iCoo (No Recalls)

hiccapop (No Recalls)
833-442-2266 hiccapop.com

IMMI (See Safe Guard)
317-896-6612 imminet.com

InspiredByDrive (No Recalls)
Formerly Columbia Medical
800-454-6612 inspiredbydrive.com

JD E-Commerce America Limited

Marainbow (made any date, also sold under Joybuy Express) AS WELL AS "materially similar products that may suffer from the noted defects." (Find an image that's representative of affected products and a list of product names, including Portable Infant Safe Seat, at www.saferideneews.com/unsafe-products.)

Problem: The device does not comply with FMVSS 213 in several ways. Its design prohibits it from being installed properly, and installation labels display incorrect instructions. It may also lack an owner's manual and/or recall registration card.

Call: 302-426-4543 for a refund. Consumer will be required to prove that the product has been destroyed by sending images to overseas-service@jd.com.

Owners may also contact NHTSA at 888-327-4236 (reference NHTSA Campaigns #22C-007 and #22C-008).

Editor's Note: Due to the integral nature of some of the defects, as well as the seriousness of the risk, **DO NOT USE this product.** It should be replaced with a 213-compliant CR that's suitable for the child.

Joybuy Express

(See J.D. E-Commerce America Limited, the recall listed immediately prior.)

Kiddy (No U.S. website/phone; all units expired)

Kids Embrace (No Recalls)
866-947-3287
kidsembrace.com

Lilly Gold (See Triple Play)

Maxi-Cosi (See Dorel)

Merritt Manufacturing
317-409-0148 eztether.com

Car Bed

Angel Ride car beds made 8/8/19-10/24/19. **Problem:** Harness may not be sewn correctly at the buckle attachment point
Call: 317-409-0148 for a harness replacement kit.

Mifold (See Carfoldio)

Nania (See BabyRide under Combi)

Nuna
855-686-2872 nunababy.com

Convertible Seats

Rava all units made 7/16/16-10/25/23 with padding that does not cover the front harness adjuster. **Problem:** If debris has dropped down into the front harness adjuster area and collected on the locking mechanism, it can prevent the teeth from clamping on the adjuster strap so the harness may not stay tight. Owners will be supplied with a cleaning kit, care instructions, and a new seat pad that will protect this area of the CR. If the harness is functioning properly and staying snug on the child, the CR can continue to be used, following all instructions, while awaiting the kit. **Call:** 855-686-2891 or visit www.nunababy.com/usa/recalls-rava1.

Orbit Baby orbitbaby.com

Peg Perego (No Recalls)
800-671-1701 pegperego.com

Phil&Teds (No Recalls)

Porsche (Contact Britax)

Portable Child/Infant Seat
(See J.D. E-Commerce America Limited)

R82 (See Etac)
844-876-6245 etac.us.com

Recaro
888-973-2276 us.recaro-cs.com

Convertible Seats

ProRide all models beginning with 332.01 made 4/9/10-6/9/15.

Performance Ride all models beginning 33301 made 1/15/13-6/9/15.

Problem: Tether may detach from car seat during crash increasing risk of injury to child or other occupants. **Call:** 866-628-4750

Note: These units are now all expired.

Safe Traffic System (No Recalls)
847-233-0365 safetrafficsystem.com

SafeGuard (No Recalls)
800-586-7839 safeguardseat.com

Safeline Kids (See Tripleplay)

Safety 1st (See Dorel)

Sentry Baby Products (No Recalls)
OOB; contact info no longer available.

Simple Parenting (No Recalls)
844-477-9539 www.doona.com/en-US

Snug Seat (See Etac)

Snugli
OOB; Contact Evenflo. All units expired.

Summer Infant (No Recalls)
800-268-6237 summerinfant.com

Team-Tex America

(See Combi BabyRide)

Thomashilfen (No Recalls)
866-870-2122 thomashilfen.com

Tomy International (No Recalls)
800-704-8697

Triple Play (No current recalls)
646-484-8112 lillygold.com

Uppababy (No Recalls)
781-413-3000 uppababy.com

Urbini (See Goodbaby)

WAYB
888-924-9292 wayb.com

Forward-Facing Seat

Pico travel car seat
Made 2/1/19 through 8/23/19
Model number ending in -001.

Problem: Aluminum tubular frame on headrest can potentially detach from seat, leading to an increased risk of injury in a crash.

Call: 888-924-9292. Go to www.wayb.com/repair for instructions to ship product for repair.