



Car Seat Recalls/Defects & Safety Notices - Revised 8/12/26

Ensure you are looking at the most recent list! Scan the code (left) using a smartphone camera or app. This printed list includes recalls on any child restraint manufactured after 1/1/2016 (most recent addition shaded gray). Note: Since most car seats expire in fewer than 10 years from the date of manufacture, some car seats on this list may no longer be covered by the recall notice; rather than be repaired, they should be replaced and properly discarded. Contact the manufacturer for all recall details.

Find this list under Resources at www.saferidenews.com. This recall list format was originally developed by the WA State Safety Restraint Coalition and is currently maintained by Safe Ride News Publications.

4moms

888-614-6667

4moms.com

Infant Seat

Self-installing Car Seat made 7/1/16-10/31/16. **Problem:** Hooks that lock the carrier to the base may stick or fail to attach. Until replaced, double check proper locking into base by pulling up on carrier handle; or install carrier without base. **Call:** 888-614-6667 or visit 4moms.com/recalls

Note: These units are now all expired.

Angel Guard

(See Merritt Manufacturing)

Axkid

(No recalls)

800-357-4690 Support.na@axkid.com

babyark

(No recalls)

888-922-2927 babyark.com

Baby Jogger

(No current recalls)

800-241-1848 babyjogger.com

Baby Trend

800-328-7363

babytrend.com

Combination Seat

Hybrid 3-in-1 Combination

Booster (Desert Blue, from Walmart)

Model: #FB49E14A 12/21

Made on: 12/6/2021

Problem: The LA strap, if frayed, may not meet the strength required by FMVSS 213 and FMVSS 209. Registered owners will automatically receive a replacement LA attachment and instructions. Until received, install CR using a seat belt. If a seat belt *cannot* be used, inspect the original LA strap carefully for fraying or other damage and, if in good condition, use it only until it can be replaced.

Call 800-328-7363 for information or search Recalls and Safety Notices at www.babytrend.com.

Hybrid 3-in-1 LX model FB48417 made 7/14/16 sold only at Wal-Mart & model FB58181 made 7/23/16 sold

only at Military Exchanges. **Problem:** In a crash, center adjuster may detach in harnessed mode if child weighs more than 40 pounds. **Call:** 800-328-7363 (NOTE: This car seat in harness mode is now expired.)

Bergeron

(No Recalls)

800-371-2778 adaptivemall.com

Britax

888-427-4829

www.britaxusa.com

RF-Only/Infant Seats

B-Safe 35 and B-Safe 35 Elite

Made 11/1/15 through 5/31/17.

BOB B-Safe 35 (w/stroller system) model #EXLT34A and units with model numbers that begin E9LT3

B-Safe 35 model #S921800 and units with model numbers that begin E1A, E9LU, S020, S04, S0.

B-Safe 35 Elite models with model numbers that begin E1A2, E9L, EXA216L, and S0

Problem: Center tab on chest clip can break, presenting choking hazard.

Call: 833-474-7016.

Note: These units are now all expired.

All-in-One Seat

One4Life Slim ClickTight models E1D197A, E1D197B, E1D197F, E1D197G; made July 10-12, 2024

Problem: The child weight limit for using the LA attachment to install the CR rear facing is incorrectly stated on labels and in owner's manuals. The RF LA attachment child weight limit should be 35 pounds.

Call: 888-427-4829

BubbleBum

(No Recalls)

800-969-6586 bubblebum.co/us

Carfoldio

(No Recalls)

mifold.com; out of business

CARES

(No Recalls; airplane only)

800-299-6249 kidsflysafe.com

Century

(No Recalls)

centurybaby.com

Chicco

877-424-4226

chiccousa.com

Combination Seat

MyFit Zip Air

Model: 07079561970070 and 04079561190070

Made: 9/1/2020—8/31/2024

Problem: When the CR is in recline positions 3 or 4 (most upright) AND is installed using a lap-only belt AND the tether is not attached, a child riding in the CR's harness mode may experience more chest acceleration in a crash than what is allowed by FMVSS 213. Until the recall is repaired, the CR is safe to use in booster mode or in harness mode if it is installed using the LA attachment or a lap-shoulder belt (and tether), or a lap-only belt with a tether, as stated in instructions.

Call 877-424-4226

CLEK Inc.

866-656-2462

clekinc.com

RF-Only/Infant Seats

Liing Model LG19U1 and

Liingo Model LGO20U1

Problem #1 of 2: On units made prior to 9/15/2020, the canopy support can break under pressure, posing a choking hazard if small pieces are ingested by a child.

Call: 866-656-2462 for a stronger canopy stay; it's safe to use the CR until fixed if canopy is intact.

Problem #2 of 2: On units made prior to 2/22/2021, labels on the seat padding and insert may detach, posing a choking hazard if ingested.

Call: 866-656-2462 for replacement pad/insert; it's safe to use the CR until fixed if labels are intact.

Convertible Seats

Filo Model FL15-FO19 and

Foonf Model FO12-FO19

Made: prior to 5/21/21.

Problem: Pieces of foam cushion from under the padding can be picked loose by the child, posing a choking hazard if ingested.

Call: 866-656-2462 for a plastic insert; monitor child behavior until the repair kit is applied.

Booster Seats

Olli Model OL12U2 made 1/20/20 through 5/10/22

Ozzi Model OZ11U2 made 3/1/2020 through 5/10/22.

Problem: Diagram for lap-and-shoulder belt routing not on label.

Call: 866-656-2462 for a new label; refer to owner's manual for belt use instructions until label replaced.

Columbus Trading-Partners U.S.A, Inc.

(See CYBEX)

Combi USA, Inc.

RF-Only/Infant Seats

BabyRide RF-only car seat (no base), model #378099, manufacture dates 5/1/2016—8/31/2019.

Problem: The webbing of the 1-inch harness adjuster strap fails to meet the breaking strength requirement of FMVSS 213. Since the segment of this strap that falls *behind* the A-lock adjuster is part of the overall harness, this strength issue could potentially cause an infant to be improperly restrained in a crash.

IMPORTANT NOTES: This model is branded by its manufacturer, Nania. During a portion of the recall period, units labeled as Nania BabyRide were imported into the U.S. through a now defunct distributor, Team-Tex America. Therefore, Nania and/or Team-Tex may be prominent on the CR, packaging, and ordering information, whereas Combi, the most recent importer, may not be indicated (but is responsible). BabyRide is a CR with no base that states no minimum weight (allowing use "from birth"), sold exclusively through institutional distributors. Distribution programs are advised to check inventory and notify clientele.

Contact: Email customerservice@combiusa.com.

Note: All units are expired.

Convertible Seats

Coccoro Model 8220

Made 1/1/09 through 7/31/16.

Problem: When installed FF and secured with vehicle LAP-ONLY belt, car seat/child may experience excessive force.

(Note: Recall does not affect RF mode or when installed FF with a lap-shoulder belt and lock-off or lower anchors and tether.)

Call: Combi no longer supports car seats in the U.S.; units are expired.

Note: All units are expired.

.....
Convaid (See Etac)
844-876-6245 etac.us.com

.....
Cosco (See Dorel)

.....
CYBEX
877-242-5676 cybex-online.com

RF-Only/Infant Seats

Aton G (any variety) made before 5/10/24, with or without Swivel and SensorSafe in the name, as well as units that are part of the Eos or Aton G stroller/travel systems.

Problem: If the shell has been slid or scraped over a hard edge (like a table, countertop, or the base), plastic fingers on the shell's underside may bend, which may allow the harness hip anchoring pin(s) to become dislodged, so the harness will not properly secure the child. If the plastic fingers aren't bent and the harness is anchored properly, the CR may be used until the fix kit is added; however, advise caregivers to check the harness before each use and to avoid rough handling of the CR, which contributes to this issue.

Call: 877-242-5676 to contact CYBEX distributor Columbia Trading Partners.

Aton made 3/29/17-1/4/20

Aton Q made 3/13/17-1/3/20

Aton M made 3/17/18-1/1/20

Aton 2 made 3/29/17-10/27/20

Cloud Q made 7/6/17-10/20/20

Problem: The one-inch central harness adjuster webbing may fray too easily; when frayed, the webbing • fails to meet strength requirements • of FMVSS 213. The recall kit has a new harness adjuster strap (with end not folded/sewn) and instructions for replacement.

(Owners who previously incurred a cost for replacement due to this problem should call, as well.)

Call: 877-242-5676

Convertible Seat

Cybox Sirona M models
518000385, 518002153, 518000387,
518002145, 518002149, 518002151,
and 519000211, made 11/3/17
through 8/31/18.

Problem: It's possible for a child to pick pieces of foam from the headrest padding, which could be

an ingestion/choking hazard.

Call: 877-242-5676 to get a manufacturer-provided tape kit to apply to the lower edge of the exposed EPS foam. Warn caregivers to monitor children to ensure they do not pick at foam.

.....
Diono 855-242-5676 diono.com

All-in-1 Seats

Radian RXT, Radian R100, Radian R120, Rainier, Olympia, & Pacifica made 11/25/2013-9/25/2017.

Problem: The seat may not adequately protect a child *when used in harnessed mode & installed forward-facing*. Children using seat in booster mode are not affected. Forward-facing children using the harness, who weigh more than 65 pounds (with any installation method) MUST use top tether. For vehicles not equipped with tether anchor, use seat in booster mode. Forward-facing children using the harness who weigh 65 pounds or less whose seat is installed with a lap-only belt in vehicles without a tether anchor MUST install repair kit.

Call: 855-215-4951.

Booster Seat

Cambria 2 booster model numbers 31200-US-01, 31201-US-01, and 31202-US-01 made 9/5/2020, through 11/30/2020, and used in highback mode.

Problem: The headrest may crack and possibly separate from the booster during a crash. Diono will provide a replacement seat back. The replacement seat back does not have padding; the instructions will say to transfer the original padding to the replacement seat back and how to attach the seat back to the seat.

Call: 855-463-4666.

Dorel Juvenile Group

(Cosco, Eddie Bauer, Safety 1st, Maxi-Cosi)
800-544-1108 djgusa.com

RF-Only/Infant Seats

The base of the following models, all made February 2023 or earlier, with a self-retracting system for the LA attachment. Note: Does not include CRs with similar names that have non-retracting LA attachments.

Maxi-Cosi:

Coral XP (#IC313) made 5/1/20-2/28/23. (Also, see next recall.)

Mico XP (#IC336, #IC38) made 9/1/20-2/28/23.

Mico XP Max (#IC337) made 9/1/20-2/28/23.

Mico Luxe+, (#IC370) made 9/1/20-2/28/23.

Any replacement base with self-retracting LA attachment (#IC335) made 5/1/20-2/28/23.

Safety 1st:

onBoard 35 Secure Tech (#IC351) made 5/1/20-2/28/23.

Any replacement base with self-retracting LA attachment (Secure Tech) pre-2/23/23

Also, the recalled base may be part of these travel systems: Gia XP, Zelia 2 Max, Tayla, Tayla XP, Adorra, Mara XT, and Lila CP (Canada).

Problem: The LA attachment system may not hold the base properly. Owner's will be sent a new base. Until received, install the CR with the base (or baseless) using the vehicle seat belt only.

Call: Contact Dorel at 877-657-9546 or send an email to RetractableLatchRecall@djgusa.com

Maxi-Cosi Coral XP #IC313, all dates. (Also, see prior recall.)

Problem: The inner carrier cannot be installed in the car without the use of a supplemental device (the outer carrier) and therefore the CR fails to meet FMVSS 213 requirements, including those regarding installation and dynamic performance. Until a refund or replacement has been issued, the CR's inner carrier may be installed while properly attached to the outer carrier, per all instructions.

Call: 877-657-9546 or email CoralXPRecall@djgusa.com.

Convertible Seats

Maxi-Cosi Pria 70, Pria 85 and Pria 85 Max,

Made Jan. 1, 2019-Sept. 8, 2021

Problem: The car seat allows more forward head movement than allowed by FMVSS 213 *when used by a child weighing more than 65 pounds and installed forward-facing using a lap-only belt and no tether*. (CRs properly used in rear-facing mode are not affected.) The recall fix from Dorel is new instructions and labeling that limit use of the CR to a maximum child size of 65 pounds or 49 inches for any forward-facing installation. Owners using or intending to use the CR for a child over 65 pounds may request a free Maxi-Cosi Rodi Sport booster. Until fixed, follow these new instructions. Always attach the tether when used forward-facing, whenever possible.
Call: 877-657-9546 or email pria85recall@djgusa.com.

Combination Seats

Safety 1st Grow & Go Sprint

all models beginning CC321. (These model numbers end in GYU, GYUD, GYY, GYYD, HAO, or HAR and were made February to December 2023.)
Problem: The foam pad under the child's head is not adequately secured. If it becomes loose, a child can pick at it and choke. Dorel will send a replacement head pad with assembly instructions. While awaiting the kit, ensure foam is in place and warn caregivers to be alert to this risk.
Call: 877-657-9546 or go to gng-sprint-recall@djgusa.com

Safety 1st Boost & Go (all numbers beginning BC163 made 5/30/2023-3/7/2025),

Boost & Go Essential (all numbers beginning BC181 made 1/29/2024-3/7/2025),

Comfort Ride (all numbers beginning BC159 made 2/28/2023-3/7/2025), and

Disney Baby MagicSquad (all numbers beginning BC167 made 7/17/2023-3/7/2025).

Problem: The CR label incorrectly states that the height allowed for harness use is from 43-57 inches (110.1-144.8 cm). Until the recall fix has been applied, warn owners that the harness is not suitable for children taller than 49 inches. (The owner's manual correctly states the height range as 34-49 inches.) Dorel will send registered owners a corrected label to place over the incorrect label.

Call: 877-657-9546 or go to comfort-ride-recall@djgusa.com.

Booster Seat

Babideal Model "Storm," #BC901BPXL, made 2/28/19 and sold at Family Dollar stores. **Problem:** Some required safety labels are missing, and some present labels are for non-vehicle boosters only (wrongly indicating the booster should not be used in vehicles).
Call: 877-657-9546 to get a new fabric cover with appropriate labels. (Check unit for expiration.)

.....
Etac (incl. Convaid, R82)

844-876-6245 etac.us.com

Convertible Seats

R82 Quokka made May 2019.

Problem: A non-recall, consumer advisory: Some units, upon unboxing, have been found to have a broken RF belt guide.

Call: Consumers with this problem should call 844-876-6245 to order a free fix kit with instructions.

Evenflo

800-233-5921

evenflo.com

RF-Only/Infant Seats

Revolve180 LiteMax NXT, all U.S. units made before 4/1/2025, including standalone CRs, CRs that are part of a travel system (Shyft Intuiti, Shyft Intuiti+, Omni Ultra), and accessory bases (#CS900610000). (Note: This recall *does not* apply to any other CR with Revolve or LiteMax in the name, any CR made April 1, 2025, and later, or any CRs sold in Canada.)

Problem: The level indicator is not calibrated correctly, allowing the CR to be installed at an angle in which its performance may not meet standards in a crash. Until a repair kit is acquired, it is safe to use the CR baseless or with a compatible, non-rotating LiteMax NXT base. Using the CR's original (rotating) base, it is also safe to use if an Evenflo accessory load leg is used or if the user contacts Evenflo customer service and follows the company's specific angle-adjustment instructions. The recall does not affect use in carrier or travel system modes.

Call: 800-233-5921 or email parentlink@evenflo.com

LiteMax Factory Select CRs, model #CS100111198 made 11/1/24-1/28/26

Problem: Incorrect child weight and height limits are stated in the Spanish-language owner's manual. Until the new manual is received, the CR is safe to use provided the caregiver adheres to the correct height/weight range, as follows: 1.4 to 13.6 kg (3 to 30 lbs.) and 40 to 81 cm (15.7 to 32 inches). (Note: The CR's weight/height information is otherwise correctly stated, including on labels and packaging, in English-language manuals, and on the cover of the Spanish-language manual. The correct versions of owner's manuals are available at <https://www.evenflo.com/pages/manuals>)

Call: 800-233-5921.

LiteMax CRs included in the following travel systems: Gold Shyft (#53212311C), Sibby (#562118976C), Folio3 (#57312205C), Gold Pivot Expand Modular (#53112311C), and Omni Plus (#53312418C) made 1/1/18-12/31/24.

LiteMax 35 base, #6391600C, made 1/1/18-12/31/24.

SafeMax CRs included in the following travel systems: Pivot (#56012477C) and Pivot XPand (#57112454C) made 1/1/18-12/31/24.

Problem: The CR's recall registration postcard is not appropriate for use by U.S. consumers because the CRs were prepared for sale in Canada but shipped to the U.S. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Convertible Seats

REO by Revolve360, model numbers starting with #CS26021 made March 1, 2025, through June 30, 2026, in the U.S. and Canada. (Does not apply to any other CR with Revolve in the model name.) Note: Find the model number on a label on the back of the CR shell by raising the headrest and rotating the CR to a side-facing position.

Problem: When used in a top position (positions 10 or 11 for FF mode or position 11 for RF mode), the headrest may shift during a crash, in violation of FMVSS 213 requirements. The CR is safe to use if the appropriate headrest for the child is position 1 through 10 in RF mode or 1 through 9 in FF mode. Note: The headrest positions are numbered on the CR's shell, beneath the padding.

Call: 800-233-5921 (U.S.) or 800-265-0749 (Canada).

Revolve360 Slim, model numbers starting with #3681 (any date of manufacture, including Gold versions). Does not apply to Slim model numbers starting with CS or to any other model with Revolve in the model name.

Problem: Children may be able to access and pick at the CR head restraint's underlying foam, which can cause a choking hazard.

Call: 800-233-5921. Evenflo will provide a tape kit with instructions for applying to the head restraint foam. Until fix is applied, the CR is safe to use if caregivers are warned to monitor children to ensure they do not pick at foam.

Sonos (#3471205C)

Tribute (Factory Select, #3811198C) made 1/1/18-12/31/24.

Problem: The CRs were prepared for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not

appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

SureRide/Titan 65, model #3712198, made 3/13/25-5/1/25, purchased from Evenflo's institutional sales department.

Problem: The CR may have been shipped with a manual written for a different Evenflo model. CRs with manuals that say SureRide/Titan 65 on the cover are not affected.

Call: 800-233-5921.

Titan 65, models in the U.S.:

#3711198, 3712198, CS200312198, CS200311198. Model in Canada: #37111835C. Made 3/1/25-12/11/25.

Problem: The CR may be missing a tether, affecting installation for forward-facing mode; if the tether is present, no action is needed. Evenflo will supply a tether and installation instructions. While awaiting the tether, consumers may use the CR in rear-facing mode, if appropriate for the child. CPS programs with this model/date in inventory are advised to confirm tether presence prior to distribution.

Call: 800-233-5921 (U.S.) or 800-265-0749 (Canada), or email ParentLink@evenflo.com.

Titan 65, made 5/20/22: Recall applied to only one unit, which had missing labels. CR was returned to Evenflo and destroyed. No other CRs have this problem.

All-in-1 Seats

All4One, all dates of the following model numbers in the U.S. and Canada. Note: All units of this model were made between January 2022 and June 2024. Model Numbers:

39312234, 39312234C, 39312240, 39312240C, 39312241C, 39312408, 39312408C, 39312408PAL, 39312409, 39312440, 39312441, 39312441C, 39312441COM, 39312441POP, 39312442COM

Problem: When installed rear facing, the CR may change angle position during a crash, creating the risk that an adjacent occupant's hand(s) could be injured if caught between the moving parts at the time of impact. (Forward facing and booster modes not affected by this recall.)

Evenflo will provide an

equivalent replacement CR. The CR is safe to use while awaiting the replacement, provided adjacent passengers do not rest body parts in the opening above the recline indicator.

Call: U.S. 800-233-5921/ Canada: 800-265-0749.

EveryFit (#CS300212376C, CS300212408C)

EveryKid (#CS300212340C)

EveryStage DLX (#39212241C)

Gold Revolve360 Extend

(#38412311C)

Symphony DLX (#34612173C, #34631038C)

Symphony Elite (#34611709C),

Symphony Sport (#34512335C), made 1/1/18-12/31/24.

Problem: The CRs were prepared for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Combination Seats

Maestro Sport (#34912200C, #34912258C)

Problem: The CRs were made for sale in Canada but shipped to the U.S., so the CR's recall registration postcard is not appropriate for U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their CR at www.evenflo.com.

Call: 800-233-5921.

Evolve #34411700 and 344117421 made before 2/9/16.

Transitions #34411686, 34411695, and 34411029 made 12/18/14-1/29/16.

Problem: In harness mode, child may reach button and loosen harness.

Call: 800-233-5921.

Note: These units are now all expired.

Booster Seats

Amp (#34011243C)

Big Kid LX (#31912381C)

Go Time Sport (#35012433C)

Spectrum (#34212036C)

made 1/1/18-12/31/24.

Problem: The boosters were prepared for sale in Canada but

shipped to the U.S., so the recall registration postcard is not appropriate for use by U.S. consumers. Evenflo will mail owners a correct recall registration card. In the meantime, advise owners to complete recall registration for their booster at www.evenflo.com.

Call: 800-233-5921.

E-Z-On Products (No recalls)
800-323-6598 ezonpro.com

Goodbaby USA
(See Evenflo and Cybex)

Graco
800-345-4109 gracobaby.com

RF-Only/Infant Seats

SnugRide Turn & Slide CRs, all models, including #2231806, 2231809, 2231881, 2231884, 2231885, 2231887, base (sold separately) #2231810, CR as part of Modes Nest travel system #2243083. Made 12/1/2025 through 3/27/2026. (Note: The recall affects the base only, not the CR or the stroller. Other Snug Ride and rotating models are not affected by this recall.)

Problem: In a crash, the CR shell may detach from the base. Stop using the base; while awaiting a replacement, the CR may be installed without the base using a seat belt. Owners of CRs may select from four replacement CRs. Owners of the base-only product will get a replacement base. (Note: Replacement options do not include a base with turn/slide features).

Call: 800-345-4109.

Convertible Seats

Extend2Fit model 1954477 made 11/27/15-1/20/16.

Problem: Recline label affixed to wrong location may result in infant too upright or toddler too reclined. To confirm unit is affected by recall, also check the recline labels (including the one identifying recline positions 1-6); on each side of seat, they should all be one language (English one side, Spanish the other. If they are not in same language, the unit is subject to this recall.

Call: 800-345-4109

Note: These units are now all expired.

Booster Seats

Turbo Booster Models:

- 1963973 made 3/8/16-4/2/16
- 1963974 made 12/22/15-3/30/16
- 1963975 made 12/22/15-3/17/16
- 1963976 made 2/17/16-3/24/16
- 1967886 made 1/13/16-4/5/16

• 1975173 made 3/29/16
Problem: Owner's manual omits instruction to prevent seat from becoming projectile by buckling it when not in use. The effectiveness of the seat as a booster for the child is unaffected. (Check for expiration.)
Call: 800-345-4109.

Harmony

877-306-1001 harmonyjuvenile.com

Big Boost Deluxe made 11/1/15-6/24/17. **Problem:** In a crash, seat belt may cause excessive force on child's chest increasing risk of injury. **Call:** 877-306-1001. (Check for expiration.)

hiccapop (No Recalls)
833-442-2266 hiccapop.com

IMMI (No recalls)
317-896-6612 imminet.com

InspiredByDrive

(No recalls)
Formerly Columbia Medical
800-454-6612 inspiredbydrive.com

JD E-Commerce America Limited

Marainbow (made any date, also sold under Joybuy Express) AS WELL AS "materially similar products that may suffer from the noted defects." (Find an image that's representative of affected products and a list of product names, including Portable Infant Safe Seat, at www.saferidenews.com/unsafe-products.)

Problem: The device does not comply with FMVSS 213 in several ways. Its design prohibits it from being installed properly, and installation labels display incorrect instructions. It may also lack an owner's manual and/or recall registration card.

Call: 302-426-4543 for a refund. Consumer will be required to prove that the product has been destroyed by sending images to overseas-service@jd.com.

Owners may also contact NHTSA at 888-327-4236 (reference NHTSA Campaigns #22C-007 and #22C-008).

Editor's Note: Due to the integral nature of some of the defects, as well as the seriousness of the risk, **DO NOT USE this product.** It should be replaced with a 213-compliant CR suitable for the child.

Joie (No recalls)
866-798-7866 info.us@joiebaby.com

Joybuy Express

(See J.D. E-Commerce America Limited, the recall listed immediately prior.)

Kids Embrace (No recalls)
866-947-3287 kidsembrace.com

Lilly Gold (See Triple Play)

Maxi-Cosi (See Dorel)

Merritt Manufacturing
317-409-0148 eztether.com

Car Bed

Angel Ride car beds made 8/8/19-10/24/19. **Problem:** Harness may not be sewn correctly at the buckle attachment point

Call: 317-409-0148 for a harness replacement kit.

Nania (See BabyRide under Combi)
Nuna
855-686-2872 nunababy.com

Convertible Seats

Rava all units made 7/16/16-10/25/23 with padding that does not cover the front harness adjuster. **Problem:** Harness may not stay tight if debris has dropped into the front harness adjuster and collected on the locking mechanism because teeth cannot properly clamp onto the adjuster strap. Owners will be supplied with a cleaning kit, care instructions, and a new seat pad that will protect this area of the CR. If the harness is functioning properly and staying snug on the child, the CR can continue to be used, following all instructions, while awaiting the kit.

Call: 855-686-2891 or visit www.nunababy.com/usa/recalls-rava1.

Orbit Baby (No current recalls)
888-829-8427 orbitbaby.com

Peg Perego (No recalls)
800-671-1701 pegperego.com

Porsche (Contact Britax)

Portable Child/Infant Seat
(See J.D. E-Commerce America Limited)

R82 (See Etac)
844-876-6245 etac.us.com

Romer (No recalls)
833-396-9977 www.romrerbaby.com

Safe Traffic System (No recalls)
847-233-0365 safetrafficsystem.com

SafeGuard (No recalls)
800-586-7839 safeguardseat.com

Safeline Kids (See Tripleplay)

Safety 1st (See Dorel)

Sentry Baby Products (No recalls)
OOB; contact info no longer available.

Simple Parenting (No recalls)
844-477-9539 www.doona.com/en-US

Snug Seat (See Etac)

Snugli
OOB; Contact Evenflo. All units expired.

Team-Tex America
(See Combi BabyRide)

Thomashilfen (No recalls)
866-870-2122 thomashilfen.com

Tomy International (No recalls)
800-704-8697

Triple Play (No current recalls)
646-484-8112 lillygold.com

Uppababy (No recalls)
781-413-3000 uppababy.com

Urbini (See Goodbaby)

WAYB
888-924-9292 wayb.com

Forward-Facing Seat

Pico travel car seat, made 2/1/19 - 8/23/19, model # ending in -001.

Problem: Aluminum tubular frame on headrest can detach from seat, leading to risk of injury in a crash.

Call: 888-924-9292. Go to www.wayb.com/repair for instructions.